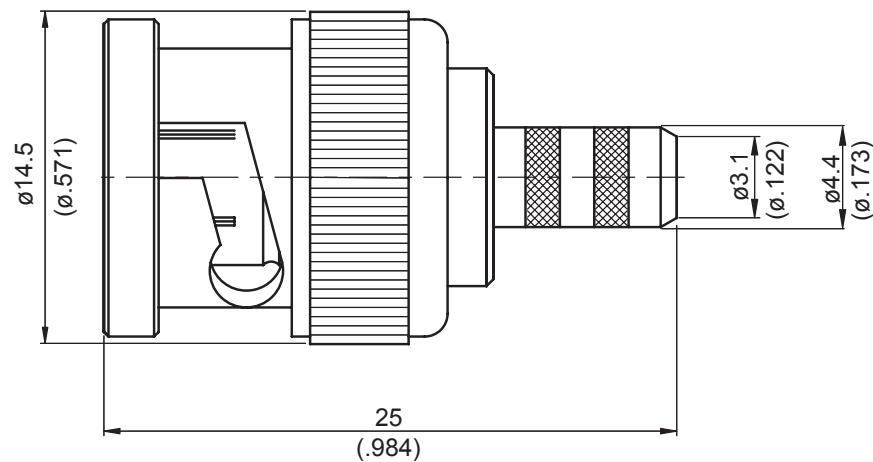


BNC3100-L200

BNC Plug Crimp
For JBY200, LMR200; 1.8GHz VSWR 1.2

50Ω



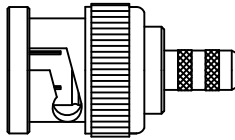

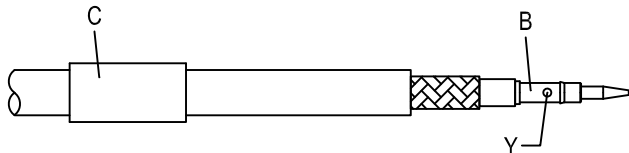
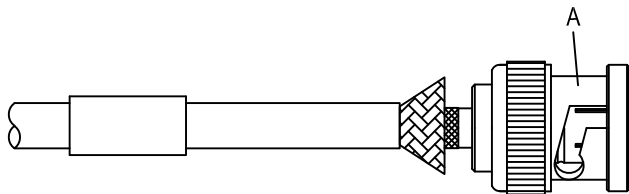
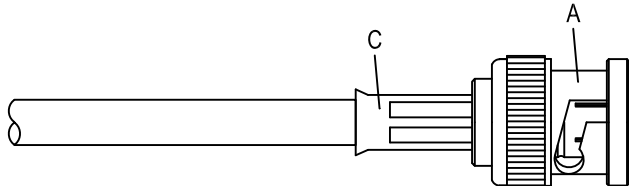
Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Gasket	Silicon	
Spring	SK5	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 10.22 g

Suitable Cables:JBY200,LMR200

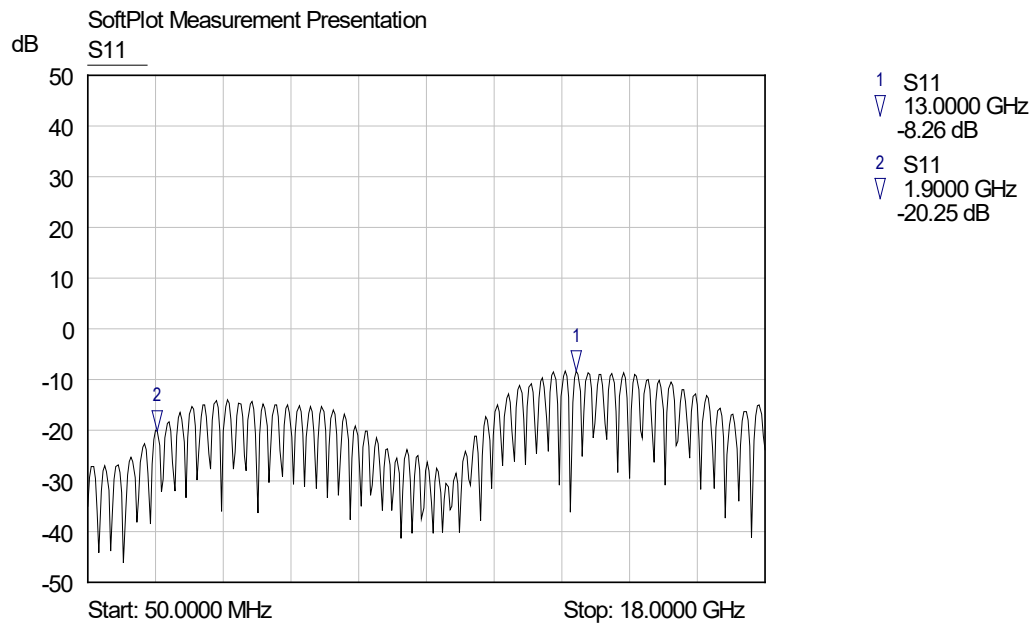
BNC	BNC3100-L200																		
<div>Interface</div> MIL-STD-348B																			
<div>Electrical Data</div> <table> <tr> <td>Impedance</td><td>50Ω</td></tr> <tr> <td>Frequency range</td><td>DC to 1.8GHz</td></tr> <tr> <td>VSWR</td><td>≤ 1.2 (DC to 1.8GHz)</td></tr> <tr> <td>Insertion loss</td><td>$\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB</td></tr> <tr> <td>Insulation resistance</td><td>$\geq 5000\text{M}\Omega$</td></tr> <tr> <td>Contact resistance inner conductor</td><td>$\leq 1.5\text{m}\Omega$</td></tr> <tr> <td>Contact resistance outer conductor</td><td>$\leq 1\text{m}\Omega$</td></tr> <tr> <td>Dielectric withstanding voltage (at sea level)</td><td>1500 V rms</td></tr> <tr> <td>Working voltage (at sea level)</td><td>500 V rms</td></tr> </table>		Impedance	50Ω	Frequency range	DC to 1.8GHz	VSWR	≤ 1.2 (DC to 1.8GHz)	Insertion loss	$\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB	Insulation resistance	$\geq 5000\text{M}\Omega$	Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$	Contact resistance outer conductor	$\leq 1\text{m}\Omega$	Dielectric withstanding voltage (at sea level)	1500 V rms	Working voltage (at sea level)	500 V rms
Impedance	50Ω																		
Frequency range	DC to 1.8GHz																		
VSWR	≤ 1.2 (DC to 1.8GHz)																		
Insertion loss	$\leq 0.1 \times \sqrt{f(\text{GHz})}$ dB																		
Insulation resistance	$\geq 5000\text{M}\Omega$																		
Contact resistance inner conductor	$\leq 1.5\text{m}\Omega$																		
Contact resistance outer conductor	$\leq 1\text{m}\Omega$																		
Dielectric withstanding voltage (at sea level)	1500 V rms																		
Working voltage (at sea level)	500 V rms																		
<div>Mechanical Data</div> <table> <tr> <td>Recommended coupling nut torque</td><td>0.6 to 2.5 inch lbs</td></tr> <tr> <td>Coupling nut retention force</td><td>≥ 101.2 lbs</td></tr> <tr> <td>Contact captivation-axial</td><td>≥ 6.1 lbs</td></tr> <tr> <td>Durability (mating)</td><td>≥ 500</td></tr> </table>		Recommended coupling nut torque	0.6 to 2.5 inch lbs	Coupling nut retention force	≥ 101.2 lbs	Contact captivation-axial	≥ 6.1 lbs	Durability (mating)	≥ 500										
Recommended coupling nut torque	0.6 to 2.5 inch lbs																		
Coupling nut retention force	≥ 101.2 lbs																		
Contact captivation-axial	≥ 6.1 lbs																		
Durability (mating)	≥ 500																		
<div>Environmental Data</div> <table> <tr> <td>Temperature range</td><td>-65°C to +165°C</td></tr> <tr> <td>Thermal shock</td><td>MIL-STD-202, Method 107, Condition B</td></tr> <tr> <td>Moisture resistance</td><td>MIL-STD-202, Method 106</td></tr> <tr> <td>Corrosion</td><td>MIL-STD-202, Method 101, Condition B</td></tr> <tr> <td>RoHS</td><td>Compliant</td></tr> </table>		Temperature range	-65°C to +165°C	Thermal shock	MIL-STD-202, Method 107, Condition B	Moisture resistance	MIL-STD-202, Method 106	Corrosion	MIL-STD-202, Method 101, Condition B	RoHS	Compliant								
Temperature range	-65°C to +165°C																		
Thermal shock	MIL-STD-202, Method 107, Condition B																		
Moisture resistance	MIL-STD-202, Method 106																		
Corrosion	MIL-STD-202, Method 101, Condition B																		
RoHS	Compliant																		
<div>Tooling</div> <table> <tr> <td>Crimping tool</td><td>CRT-1 or CRT-2</td></tr> <tr> <td>Crimp insert</td><td>INSERT-B</td></tr> </table>		Crimping tool	CRT-1 or CRT-2	Crimp insert	INSERT-B														
Crimping tool	CRT-1 or CRT-2																		
Crimp insert	INSERT-B																		

CABLE ASSEMBLY INSTRUCTION

BNC3100-L200		DATE	2021/02/25	REV	A
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-B IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 5.5mm/0.217inch HEX SECTION OF INSERT-B)		
APPROVED		CHECKED		DRAWING	
				Albert	

BNC3100-L200

S11



勝特力電材超市-龍山店 886-3-5773766
勝特力電材超市-光復店 886-3-5729570
勝特力电子(上海) 86-21-34970699
勝特力电子(深圳) 86-755-83298787
<http://www.100y.com.tw>