

29

22.2

2.75

0

2.75

17.8

6.5

0

6.5

17.9

15

46.3

ISOMETRIC VIEW

勝特力電材超市-龍山店 886-3-5773766

勝特力電材超市-光復店 886-3-5729570

勝特力电子(上海) 86-21-34970699

勝特力电子(深圳) 86-755-83298787

http://www.100y.com.tw

TABLE 1.

TAPE	PART NO.	WIRE RANGE (mm²)	INSULATION DIA. (mm)	FINISH
MCP2.8	1-964298-3	0.2 - 0.5	1.15 - 1.6	CuSn, Gold
	2-964298-1			CuFe, Tin
	1-964300-3	0.5 - 1.0	1.4 - 2.1	CuSn, Gold
	2-964300-1			CuFe, Tin
	2-962916-2	1.0 ~ 2.5	MAX 3.0	CuFe, Silver
	2-962916-1			CuFe, Tin
	1-962916-2			CuSn4, Silver
	1-962916-1			CuSn4, Tin
MCP6.3	1-962917-1	0.5 - 1.0	1.4 - 2.1	CuSn, Tin
	1-962917-2			CuSn, Silver
	2-962917-1			CuFe, Tin
	2-962917-2			CuFe, Silver
	1-962918-1	1.5 - 2.5	2.2 - 3.0	CuSn, Tin
	1-962918-2			CuSn, Silver
	2-962918-1			CuFe, Tin
	2-962918-2			CuFe, Silver
	1-962919-1	2.5 - 4.0	2.7 - 3.7	CuSn, Tin
	1-962919-2			CuSn, Silver
	2-962919-1			CuFe, Tin
	2-962919-2			CuFe, Silver

TABLE 2.

TAPE	PART NO.	INSULATION DIA. (mm)	COLOR	
MCP2.8	828904-1	1.2 - 2.1	BLUE	
	828904-2		BLUE	
	828905-1	2.2 - 3.0	WHITE	
	828922-1		NATURAL	
MCP6.3	828986-1	CAVITY PLUG		BROWN
	963243-1	1.4 - 2.1	BLUE	
	963244-1	2.2 - 3.0	WHITE	
	963245-1	3.4 - 3.7	YELLOW	
	100132-1	CAVITY PLUG		BLACK

TABLE 3.

PART NO.	DESCRIPTION	MATERIAL	COLOR
1897209-2	CAP HSG	PA66-GF15	BLACK

NOTE

1. GENERAL TOLERANCE : ±0.3, ±3.0°

2. THE MATING CONNECTOR : 1897210-1

3. APPLICABLE TAB CONTACT P/N: TABLE 1

4. APPLICABLE WIRE SEAL P/N: TABLE 2

THIS DRAWING IS A CONTROLLED DOCUMENT FOR TYCO ELECTRONICS CORPORATION
IT IS SUBJECT TO CHANGE AND THE CONTROLLING ENGINEERING ORGANIZATION
SHOULD BE CONTACTED FOR THE LATEST REVISION.

DIMENSIONS:
mm

TOLERANCES UNLESS
OTHERWISE SPECIFIED

0 PLC	±0.5
1 PLC	±0.5
2 PLC	±0.13
3 PLC	±0.013
4 PLC	±0.0001
ANGLES	±

MATERIAL

SEE TABLE

FINISH

DWN
CH LEE

CHK
YJ YOUN

APVD
JK SONG

PRODUCT SPEC

APPLICATION SPEC

WEIGHT

CUSTOMER DRAWING

NAME

MCP HYB 4P CAP HSG

SIZE

CAGE CODE

DRAWING NO

RESTRICTED TO

A3

00779

1897209

-

SCALE

SHEET

OF

REV

2:1

1

1

A1

TE Connectivity

TE

1470-19 (3/11)



The product described in this document has not been fully tested to ensure conformance to the requirements outlined below. Therefore, TE Connectivity (TE) makes no representation or warranty, express or implied, that the product will comply with these requirements. Further, TE may change these requirements based on the results of additional testing and evaluation. Contact TE Engineering for further details.

MCP HYB 4P Connector

1. SCOPE

1.1. Content

This specification covers the requirements for product performance, test methods and quality assurance provisions of MCP HYB 4P Connector.

1.2. Qualification

When tests are performed on the subject product line, procedures specified shall be used. All inspections shall be performed using the applicable inspection plan and product drawing.

1.3. Qualification Test Results

Successful qualification testing on the subject product line has not been completed. The Qualification Test Report number will be issued upon successful qualification testing.

2. APPLICABLE DOCUMENTS AND FORMS

The following documents and forms constitute a part of this specification to the extent specified herein. Unless otherwise indicated, the latest edition of the document applies.

2.1. TE Documents

- 1897209: Customer Drawing (MCP 4P CAP)
- 1897210: Customer Drawing (MCP 4P PLUG)

3. REQUIREMENTS

3.1. Design and Construction

Product shall be of the design, construction, materials and physical dimensions specified on the applicable product drawing.

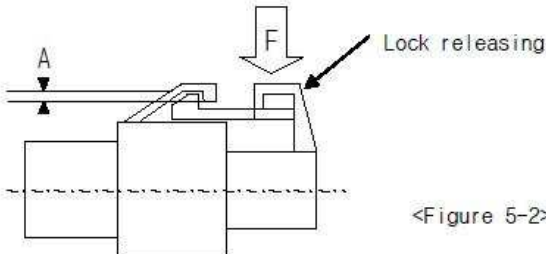
3.2. Ratings

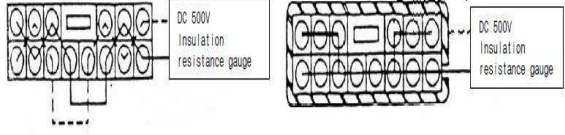
Voltage	Temperature	Humidity
12V DC	25±5°C	60±20%

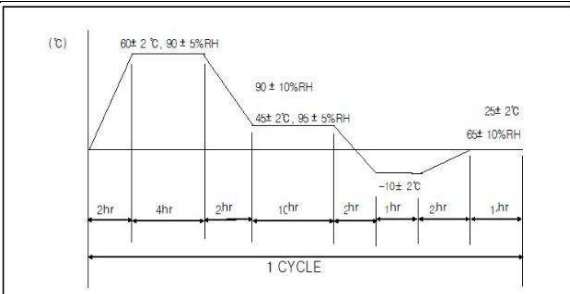
3.3. Test Requirements and Procedures Summary

Unless otherwise specified, all tests shall be performed at ambient environmental conditions.

TEST DESCRIPTION	REQUIREMENT	PROCEDURE
------------------	-------------	-----------

Appearance	No crack, damage, distortion are permitted	Using sense of sight and touch.												
CONN engage and disengage force	Max 14 kgf and less	Measure force by inserting and disengaging the connector with terminal assembled at constant 50 mm/min speed. However, remove lock part when measuring disengage force.												
Reverse insertion between housings	It shall not be incorrectly inserted by applying force of 20kgf.	Insert the housing with terminal by pushing it in reverse direction with applying 20kgf.												
Contact to HSG Inverse Force	Min 1.5kgf	Crimp cable of maximum size on terminal and then insert it into housing by end of insulation barrel in the reserve direction.												
Strength of HSG lock	Min 10kgf	Combine housing only, fix the one side of housing in completely locked condition, and extend the other side in axial direction and 30 angle direction at a constant speed of 50mm/min. Then measure weight when lock structure is disengaged or destroyed.												
HSG lock releasing force	Max 6kgf	<p>Apply force (F) to lock releasing part, and measure weight on the point of A=0. However, cut connector and then perform test at the section in order to secure visibility.</p>  <p><Figure 5-2></p>												
Terminal retention force	110 Min 6kgf 250 Min 8kgf	Fix the housing after inserting crimped terminals. Extend one line of cable in axial direction at a speed of 50mm/min at a position 50~100mm away from crimped part, and measure weight when terminal is disengaged from the housing.												
Voltage Drop	Max 3mV/A	<p>Measure the circuit voltage drop (V) by sending voltage and current described in the table 5-1 with terminal combined on the connector. Then calculate a voltage drop (VD) in terminal by subtracting cable resistance (L) from the circuit voltage drop (V).</p> <p>1)HARNESS versus UNIT:VD =V(L3+L4)</p> <table><tr><td>Application</td><td>Open voltage</td><td>Short circuit current</td><td>Division</td></tr><tr><td>Signal circuit</td><td>20 ± 5 mV</td><td>10 mA</td><td>ECU, Sensor</td></tr><tr><td>Power circuit</td><td>13 V</td><td>1 A</td><td>Other than the above</td></tr></table> <p><Table5-1></p>	Application	Open voltage	Short circuit current	Division	Signal circuit	20 ± 5 mV	10 mA	ECU, Sensor	Power circuit	13 V	1 A	Other than the above
Application	Open voltage	Short circuit current	Division											
Signal circuit	20 ± 5 mV	10 mA	ECU, Sensor											
Power circuit	13 V	1 A	Other than the above											
Insulation resistance	Min 250 MΩ	Measure resistance between neighbor terminals (figure 5-6), and between terminal and housing surface (figure 5-7) with DC 500V insulation resistance gauge with connector combined.												

			 <p><Figure 5-6> Between neighboring terminals <Figure 5-7> Between neighboring terminal and housing surface</p>
High voltage test	No allowed insulation breakdown		Measured by applying test potential of 1000 V AC between the adjacent contact between the contact and housing.
Twisting Test - Connector Engage and Disengage Endurance Test	Appearance	No crack, damage, distortion are permitted	Apply 8kgf force on the end part of combined connector 10 times each in the (front, rear, left, right) directions perpendicular to axial direction.
	Max 10mV/A		Make combine connectors engage and disengage at 100mm/min. Perform it 50 times. (Do not use locking device)
Cold temperature test	Appearance	No crack, damage, distortion are permitted	Engage and disengage connector with terminal assembled 10 times with hands, and leave it in temperature chamber of -40°C for 120 hours. Make connector engaged and disengaged 5 times immediately, and drop it onto the concrete surface from 1m height 3 times in the direction of figure 6-1. (Voltage drop & Temperature rise test perform at normal temperature) :
	Voltage Drop	Max 10mV/A	
	Insulation Resistance	Non-Sealed CONN'R : Min 100 MΩ	
		Between terminals housing surface	
	Current Leakage	Max 1 μA	
	Temperature Rise	Max 40°C	
Cold and hot temperature shock test	Appearance	No crack, damage, distortion are permitted	Engage and disengage Connector with terminal assembled 10 times with hands, this repeats 200 CYCLE by below test condition. (Sealed : 120°C, Non-Sealed : 80°C)
	Voltage Drop	Max 10mV/A	
High temperature test	Appearance	No crack, damage, distortion are permitted	Engage and disengage connector with terminal assembled 10 times with hands, and leave it in combined state at the temperature chamber of the table 6-1 for 300 hours. Then pick it out and leave it until it returns to normal temperature.
	Voltage Drop	Max 10mV/A	
Temperature Humidity Test	Appearance	No crack, damage, distortion are permitted	Engage and disengage connector with terminal assembled 10 times with hands, and leave it at 25°C ambient temperature and 65% relative humidity for 25 hours. And perform 5 cycles of the method specified in figure 6-3

	Voltage Drop	Max 10mV/A		<div></div> <p>< Figure 6-3 : Test pattern ></p>
	Insulation Resistance	Min 100 MΩ	housing surface	
	Current Leakage	Max 1 μA		
Dust Test	Voltage Drop	Max 10mV/A		Engage and disengage connector with terminal assembled 10 times with hands, and diffuse 1.5kg Portland cement(JIS R5210) with fan (or others) for 10 seconds per 15 minutes while maintaining 150mm distance from wall in the closed container of 900~1200mm length, width and height, with connector combined. After 1 hour, measure it.
Waterproof Test	Appearance	No crack, damage, distortion are permitted		Make combined connectors engaged and disengaged 10 times by hands, and leave it in combined state at 120 °C ambient temperature for 40 minutes and then spray water of normal temperature for 2 minutes according to S2 of JIS D0203. Repeat 48 cycles of this. * JIS D0203 S2 condition: attach specimen at 400mm distance from the waterproof pipe with water spray hole or water discharge hole and rotate waterproof pipe 23 times per minute around the axis.
	Insulation Resistance	Min 100 MΩ	housing surface	
	Current Leakage	Max 1 μA		
Oil and liquid test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and perform test each sample with connector combined. A. Immerse connector in combined state for 2 hours in mixed oil of 50± 2°C ENG oil (SAE10W) or equivalent oil and B. Immerse connector in combined state for 1 hour in car gasoline (JIS K2202) at normal temperature, and then pick it out. C. Immerse connector in combined state for 1 hour in brake liquid (pure product) at normal temperature, and then pick it out. D. Immerse connector in combined state for 1 hour in 100% washer liquid (pure product) at normal temperature, and then pick it out. E. Immerse connector in combined state for 1 hour in 50% LLC (Long life coolant) at normal temperature, and then pick it out.
	Voltage Drop	Max 10mV/A		
Ozone Test	Appearance	No crack, damage, distortion are permitted		Engage and disengage Connector with terminal assembled 10 times with hands, and samples keep at 40°C and 50±5pphm Ozone for 100hour. Then pick connector out of chamber and dry it for 2hours or more.
	Voltage Drop	Max 10mV/A		
Sulfur (SO2) gas test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and expose it in combined state to sulfur gas of 40±3°C, density 10ppm, humidity 90~95%, for 24 hours. Then pick connector out of chamber and dry it for 2 hours or more.
	Voltage Drop	Max 10mV/A		

Salt water test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and pout it in 35℃ temperature regulation chamber, spray 5% salty water for 24 hours according to JIS Z2371, and, maintain room temperature without spray for 1 hour, Then repeat this four times. Then pick connector out of chamber and dry it at room temperature for 2 hours or more.																
	Voltage Drop	Max 10mV/A																		
	Insulation Resistance	Min 100 MΩ	Between terminals																	
			housing surface																	
	Current Leakage	Max 1μA																		
Complex environment endurance test	Appearance	No crack, damage, distortion are permitted		Engage and disengage connector with terminal assembled 10 times with hands, and leave it in combined state in the temperature chamber of 120℃ or 80℃ (follows table 7) for 48 hours. And then perform the following vibration test. Then measure instant short circuit according to the method of clause 4.16 for 4 hours for X, Y, Z each.																
	Crimp Tensile Strength	0.3SQ (110)	Min 6kgf																	
		2.5SQ (110)	Min 25kgf																	
		0.5SQ (250)	Min 9kgf																	
		2.5SQ (250)	Min 25kgf																	
	Voltage Drop	Max 10mV/A		<table><tr><td>Division</td><td>Condition</td></tr><tr><td>Ambient temperature/humidity</td><td>80℃, 90~95%</td></tr><tr><td>Applied current</td><td>Basic current (Connector electrodes in series.)</td></tr><tr><td>Current application cycle</td><td>120 CYCLE (45 minutes-ON, 15 minutes-OFF)</td></tr><tr><td>Vibration acceleration</td><td>4.4g</td></tr><tr><td>Frequency</td><td>20Hz ~ 200Hz (sweep time: 3 minutes or less)</td></tr><tr><td>Vibration time</td><td>40 hours for X, Y, Z each</td></tr><tr><td>Connector attaching method</td><td>Test mode A, B, C</td></tr></table>	Division	Condition	Ambient temperature/humidity	80℃, 90~95%	Applied current	Basic current (Connector electrodes in series.)	Current application cycle	120 CYCLE (45 minutes-ON, 15 minutes-OFF)	Vibration acceleration	4.4g	Frequency	20Hz ~ 200Hz (sweep time: 3 minutes or less)	Vibration time	40 hours for X, Y, Z each	Connector attaching method	Test mode A, B, C
	Division	Condition																		
	Ambient temperature/humidity	80℃, 90~95%																		
	Applied current	Basic current (Connector electrodes in series.)																		
	Current application cycle	120 CYCLE (45 minutes-ON, 15 minutes-OFF)																		
Vibration acceleration	4.4g																			
Frequency	20Hz ~ 200Hz (sweep time: 3 minutes or less)																			
Vibration time	40 hours for X, Y, Z each																			
Connector attaching method	Test mode A, B, C																			
Temperature Rise	Max 40℃																			
Instant short circuit	Max 10μs																			

3.4. Applied Part No List

TE Part no	Description
1897209-2	MCP HYB 4P CAP ASSY
1897210-1	MCP HYB 4P PLUG ASSY